Play Area / Equipment Operational Inspection

LLANHARRY COMMUNITY COUNCIL Comple					
Score	8 / 8 (100%)	Flagged items	0	Actions	0
Document No.				00	0078
Audit Title				LLANHARRY COMMU COU	
Client / Site				Llanharry Recreation Gro	ound
Conducted on				01.06.2023 13:20) BST
Prepared by				Jerry Wi	ddas
Location				Llanh	narry
Personnel					
Jerry Widdas					

Audit 8 / 8 (100%)

GENERAL SITE DESCRIPTION

Detail:

The recreation ground consists of a play area fenced by steel bow top fencing with self closing gates

A MUGA kick about area and a youth shelter

Both areas are accessed by Tarmac pathways

Benches and picnic tables are located within the play area and also outside the play area boundary













Photo 1

Photo 2

Photo 3

Photo 5



Photo 7

ITEM 6 / 6 (100%) Manufacturer identification and date of installation

MUGA area supplied by PPL date unknown

- 1 X 2 seat swing supplied and installed by Urban Recreation in 2016
- 1 X Traditional cradle seat swing Wicksteed Leisure
- 1 X Traditional Igloo climber Wicksteed Leisure
- 1 X Wheelchair roundabout supplied and installed Urban Recreation Dec 2018
- 1 X Multiplayer Unit Proludic installed Feb 2022
- 1 X Steel cable ride Record Play
- 1 X Freestanding slide Record Play
- 2 X Spring animals Fahr Industries installed Feb 2022
- 1 X Teen Shelter David Ogilvie Engineering
- 1 X Cantilever Swing supplied Urban Recreation 2016
- 9 X Fitness Items supplied Urban Recreation October 2017
- 1 X Spinning Cup supplied and installed Urban Recreation Dec 2018













Photo 8

Photo 9

Photo 10

Photo 11

Photo 12

Photo 6

1 / 1 (100%)



Item Condition

At the time of inspection all the equipment was found to be in a safe and useable condition





Photo 25

Safety Surfacing

All items of play equipment are located on wet pour rubber safety surfacing



Equipment Findings

One of the basket swing suspension ropes has been wrapped, monitor

A small fire has caused minor damage to the ball court surface, an additional fire in the opposite corner has caused minor damage to the ball court surface and paintwork on the steel grid

There is some wear on the toddler swing chains, monitor and plan for replacement in the future

There is a rubber cover missing from one of the sit up benches

At the time of inspection the access gate was not self closing

The stopper spring on the cable ride has once again started to break, would suggest using a heavier duty spring next time it is changed.



Safety Surfacing Findings

At the time of inspection all surfaces were found to be in a safe and useable condition although there are some areas of joint separation which should be monitored

The basket swing area has some self seeded grass growth that could be treated if possible while it is still manageable







Photo 34

Recommendations

monitor items noted

Other comments



Inspector Sign Off



Jerry Widdas Routine And Operational Inspector (Cert OP1200) 31.08.2023 09:17 BST

1 / 1 (100%)

Media summary



Photo 1



Photo 3



Photo 5



Photo 2



Photo 4



Photo 6



Photo 7



Photo 9



Photo 11



Photo 13



Photo 8



Photo 10



Photo 12



Photo 14



Photo 15



Photo 17



Photo 19



Photo 21



Photo 16



Photo 18



Photo 20



Photo 22



Photo 23



Photo 24



Photo 26



Photo 28



Photo 25



Photo 27



Photo 29

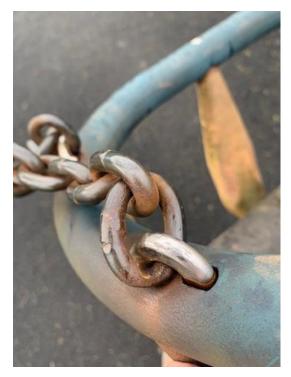


Photo 31



Photo 33



Photo 30



Photo 32











Photo 36